


## Main Boost Valve & Sleeve Kit

### 59947-07K

- 1 Main Boost Valve
- 1 Main Boost Sleeve

**Notes:** Also fits AW55-51SN, AF 23/33 and RE5F22A units.

The **59947-07K** should not be used with Sonnax oversized pressure regulator valve **59947-12K**.

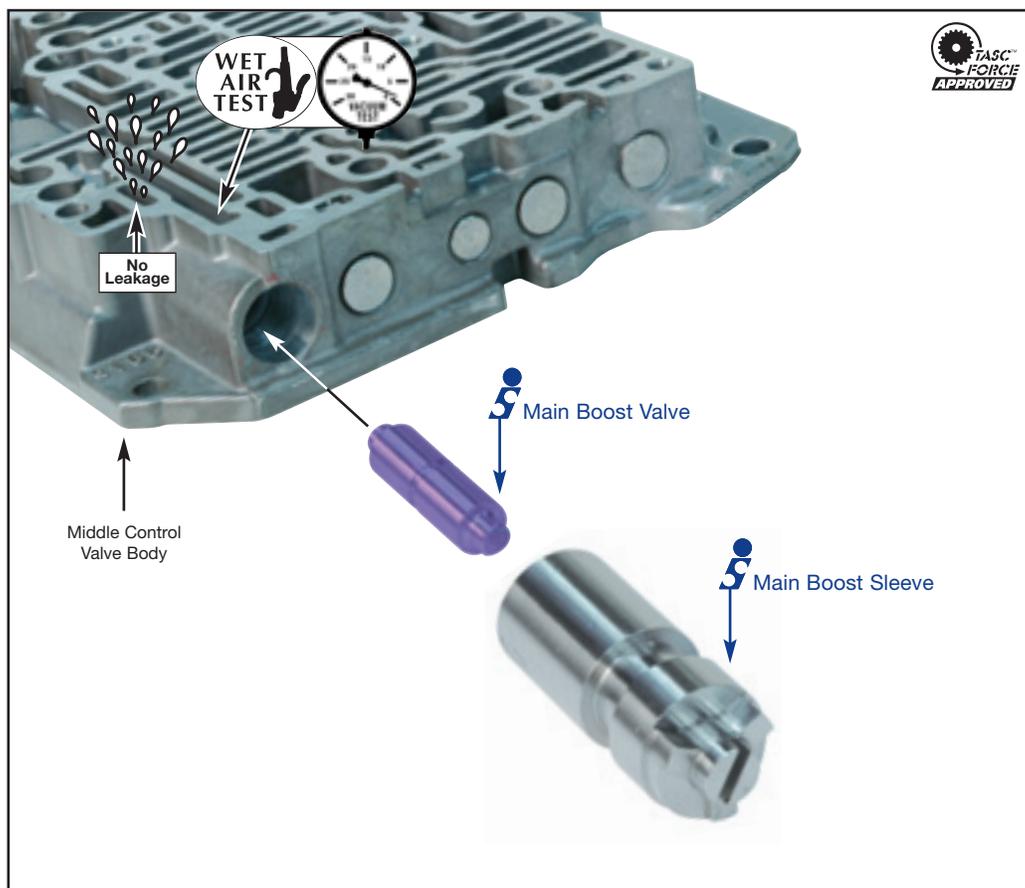

### Instructions:

1. Note step location of retainer on the OEM sleeve end prior to removal.
2. Remove and discard the OEM sleeve and valve.
3. Install the Sonnax sleeve and valve assembly as pictured.
4. Ensure retainer is set at the same step location on the replacement sleeve.

### Verification:

Perform a Wet Air Test or vacuum test of the sleeve assembly while in the bore at the outboard reverse feed port indicated. A vacuum test should reach at least 18" of vacuum. If performing a WAT, no leakage should occur at the neighboring exhaust port. For more information on valve body testing procedures, go to [www.sonnax.com](http://www.sonnax.com).

**IMPORTANT NOTE:** The pressure regulator valve bore is also subject to extreme wear, and should be checked. If it is worn severely, it must be repaired to re-establish proper pressures using kit **59947-12K**.

### Pressure Regulator Valve Test Locations

